TYAN

www.tyan.com

Server Solutions

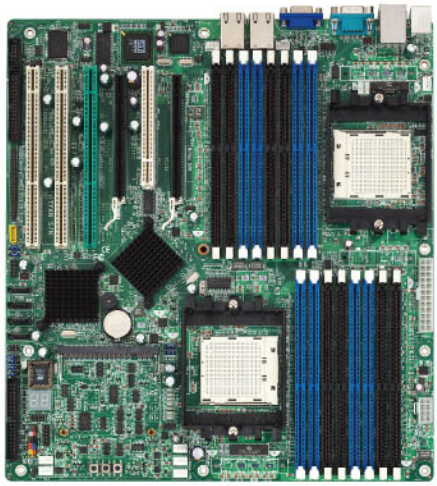

Thunder K8HM

S3892

Dual AMD Opteron™ Platform based on ServerWorks chipset HT-2000+HT-1000

- AMD Opteron™ 200 series CPU support
- ServerWorks BCM5780 (HT-2000) + BCM5785 (HT-1000) chipset
- Total sixteen(16) 184-pin 2.5-Volt DDR DIMM sockets supportsPC1600, PC2100, PC2700 Register (ECC/non-ECC) memory
- Two (2) x16 PCI Express slots (w/ x8 link)
- Three (3) PCI-X 64-bit 133/100MHz slots + One (1) PCI 32-bit 33MHz slot
- Two (2) GbE LAN + One (1) 10/100 FE LAN
- (1) PCI-X TYAN TARO™ SO-DIMM slot supports U320 SCSI or SAS/SATA II/SATA

(Specifications are subject to change without notice. Items pictured may only be representative.)

Thunder K8HM

S3892

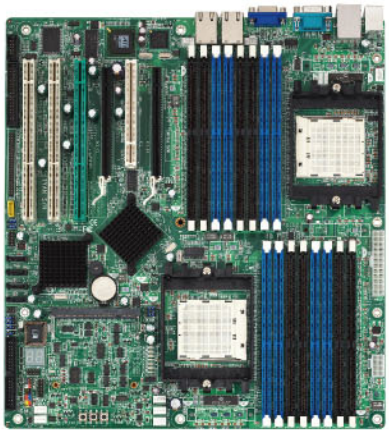

▲TOP View

Block Diagram

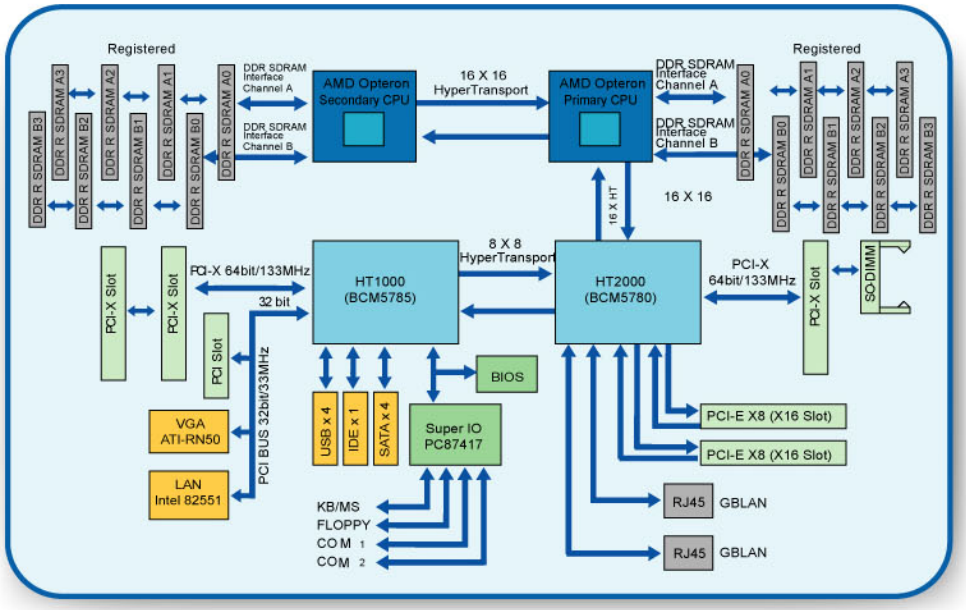

S P E C I F I C A T I O N S

Processors
- Two PGA 940-pin ZIF sockets
- Supports up to two AMD OpteronTM 200 Series processors (including dual core processors)
- Integrated 128-bit DDR Memory Controller

Chipset
- ServerWorks BCM5780 + BCM5785 chipset
- National PC87417 Super I/O chip

Memory
- 128-bit dual channel memory bus
- Total sixteen(16) 184-pin 2.5-Volt DDR DIMM sockets (8 on CPU1 and 8 on CPU2)
- Supports PC1600, PC2100, PC2700
- Registered, ECC/Non-ECC module supported

Expansion Slots
- Two (2) PCI Express x16 slots (each w/ x8 signal)
- Two (2) PCI-X 133/100MHz slot
- One (1) PCI-X 100MHz slot
- One (1) PCI 32-bit 33MHz, v2.3 compliant slot
- One (1) Tyan "TARO" SO-DIMM socket

System Management
- (2) EMC6D103S H/W monitor chips
- Eight (8) 3+1-pin fan headers support tachometer monitoring, six (6) of them with smart FAN control
- Temperature and voltage monitoring
- Watchdog timer support

Integrated I/O Interfaces
- One floppy connector
- One IDE connector
- Four SATA ports
- Four USB 2.0 ports (2 at rear, 2 via cable)
- Two COM port (1 at rear, 1 via cable)
- Tyan 2 x 9 front-panel pin header
- Tyan 2 x 6 front-panel pin header for LAN/ID LED
- 2 x 25 connector for optional Tyan IPMI SMDC

Integrated Enhanced IDE Controller
- Single-channel master mode supports up to two IDE devices
- Supports IDE drives and ATAPI-compliant devices

Back Panel I/O Ports
- Stacked PS/2 Mouse & Keyboard ports
- Stacked 2 USB ports and 1 10/100 RJ45 ports
- One 9-pin COM port
- One 15-pin VGA port
- Two side-by-side RJ-45 ports

Integrated Serial ATA controller
- (4) SATA ports at 1.5 Gb/s w/ NCQ supported
- RAID 0, 1, 5, 10 supported

Integrated LAN controllers
- Dual GbE LAN (from BCM5780)
  - Embedded in BCM5780
  - Two 10/100/1000 RJ-45 LAN ports w/ LED
- One Intel i82551QM fast Ethernet controller
  - One 10/100 RJ-45 LAN port w/ LED
  - Operating on 32bit/33MHz PCI bus

Integrated Video Controller
- ATI ES1000 controller
- 32MB DDR frame buffer

Optional Modules
- M3291, IPMI 2.0 Remote System Mgmt card
  - Renesas H8S2167 BMC controller
  - BT, KCS, Logging support
  - IPMI-over-LAN
  - Remote power on/off and reset
- M7901/M7902, Ultra 320 SCSI TARO™ card
  - Adaptec AIC-7901/7902 single/dual-channel Ultra320 SCSI controller
  - Adaptec HostRAID 0, 1, 10 supported
- M9000 SAS/SATA II TARO™ card
  - Adaptec AIC-9405/9410 SAS controller
  - Supports up to 4-port (M9000-5) and 8-port (M9000-10) SAS & SATA running at 3.0Gb/s
  - Adaptec HostRAID 0, 1 & 10 supported

BIOS
- AMI BIOS on 8Mbit LPC Flash ROM
- ACPI 2.0 and SRAT support
- PXE via Ethernet, USB device boot
- SMBIOS 2.3.1, BBS 1.1 compliant
- Headless Operation via serial console redirect
- 48-bit LBA Support

Form Factor
- Extended ATX footprint (13" x 12")
- EPS12V/ATX12V universal power connectors

Power
- Onboard dual 4-phase VRM
- EPS12V/SSI v3.51 (24 + 8) power connectors

Regulatory
- FCC Class B (DoC)
- European Community CE (DoC)

TYAN COMPUTER CORP.

Tyan Computer USA
Tel: +1-510-651-8868
Fax: +1-510-651-7688

Tyan Computer Taiwan
Tel: +886-2-8751-2200
Fax: +886-2-8797-2767

Tyan Computer Germany
Tel: +49-8136-9395-30
Fax: +49-8136-9395-44

Tyan Computer UK
Tel: +44-1256-397030
Fax: +44-7836-6800-23

Tyan Computer China
Tel: +86-10-6255-5015
Fax: +86-10-8261-8204

Tyan Computer Japan
Tel: +81-3-3837-7580
Fax: +81-3-3837-7581